

#### PUBLISHED BY E.F.JOHNSON COMPANY | WASECA, MINNESOTA 56093

## EQUIPMENT AFFECTED

Messenger 125 Part No. 242-0125-001

# REASON FOR REVISION

To prevent self-modulation when the transceiver is used with the Power Pack, Part No. 250-0715-002.

## REVISION

- 1. Unsolder the emitter of Q7. Place a ferrite bead on the emitter lead and resolder it to the circuit board.
- 2. Unsolder the white microphone lead from pin 5 of Z7. Place a ferrite bead on the lead and resolder it to the circuit board.

	PARTS REQUIRED	
QTY	PART NUMBER	PART DESCRIPTION
2	517-2002-002	0.14 x 0.24 ferrite bead

### CHANGE ACTION

Make this change as required. This change has been incorporated in all units manufactured after June 1974.

NATIONAL ASSOCIATION OF SERVICE MANAGERS