


Galaxy DX-33HP2 Echo-TB 911 Wiring Correction

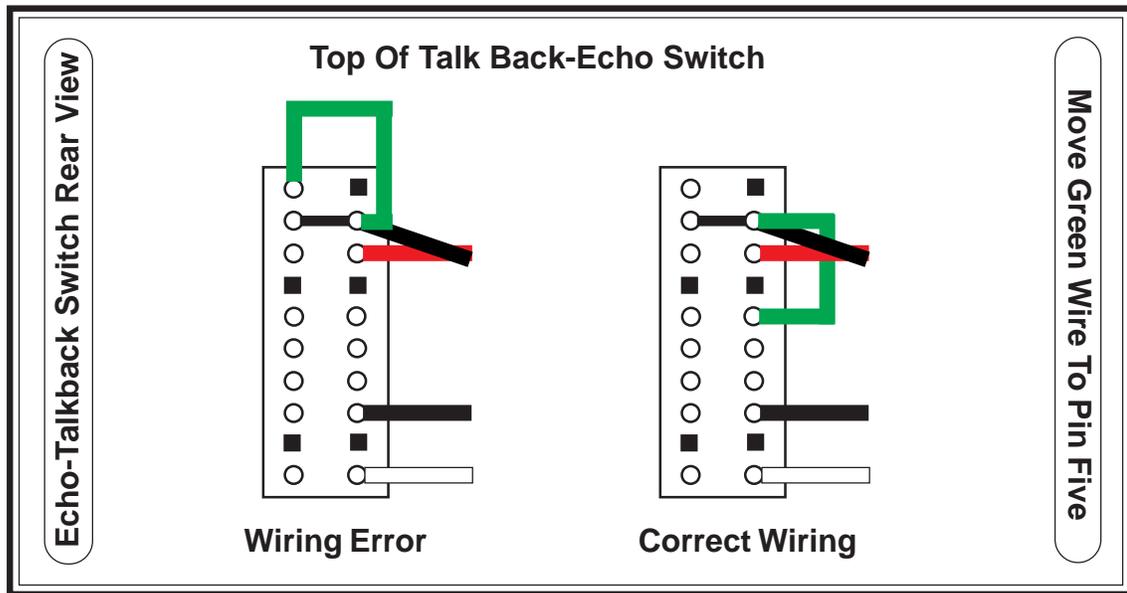

Problem:

No Echo when Echo-Talkback Switch is in the Talkback position

Information:

The following Wiring Correction should be made on all Galaxy DX-33HP2 models with a serial number beginning in M911XXXX. This modification involves removing screws from the front bezel and accessing the back side of the Talk Back-Echo Switch. The Green Wire should be removed from it's current position and moved to Pin 5 of the Right Side Contacts. The diagram above shows the corrected wiring on this model.

Notes:

Special Thanks to M.A.D. Electronics in Delmar, DE. and Galaxy Radio Repair for this info.