


## SR-490HP Back Light Modification

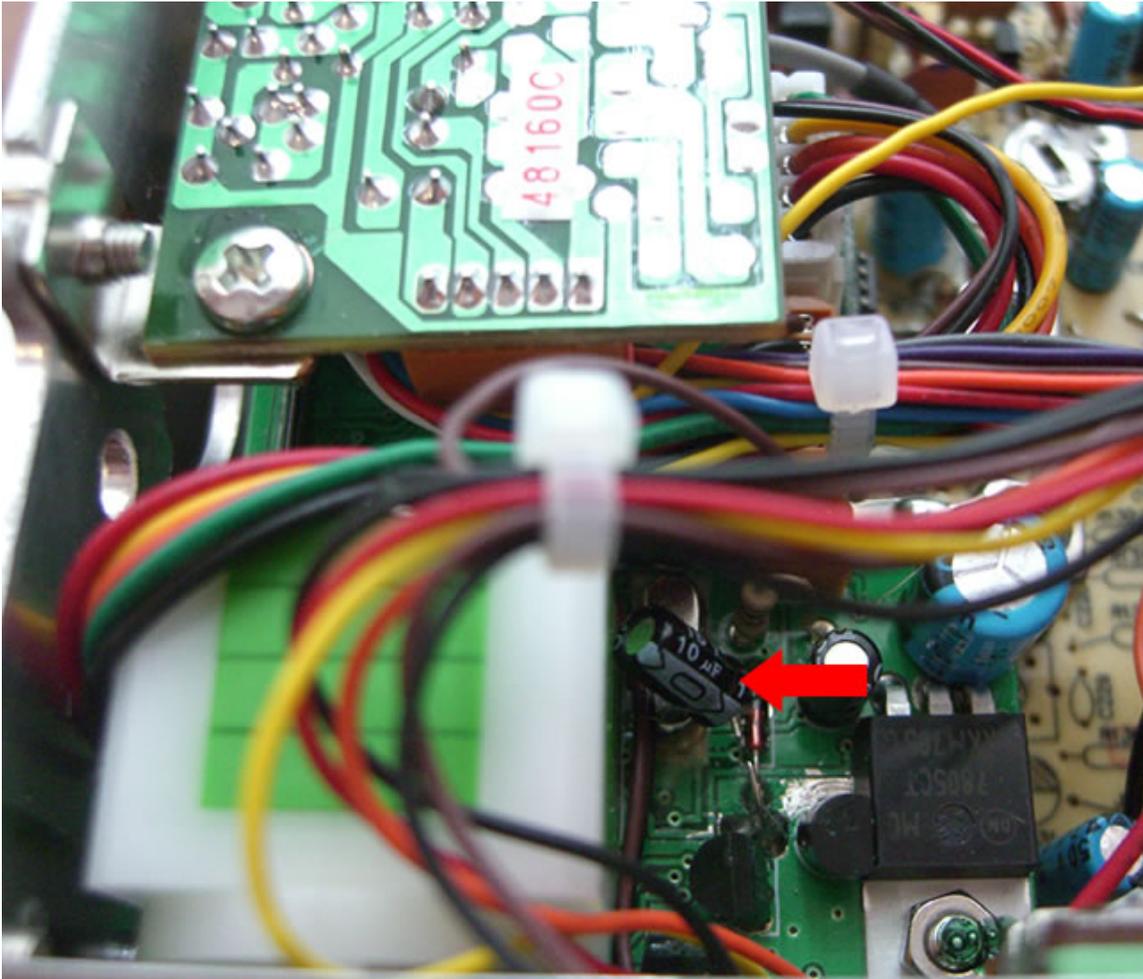

Some SR-490HP radios sold in late spring 2008 had a capacitor installed behind the channel selector. With the capacitor installed the dimmer will only dim a total of two stages instead of three. Clipping one leg of this capacitor will restore the radio to normal three stage dimmer operation. You can see in the above picture that one leg of the capacitor has already been clipped. The red arrow in the above picture points to the blue 10 uF capacitor in question.