




Raptor II Frequency Modification

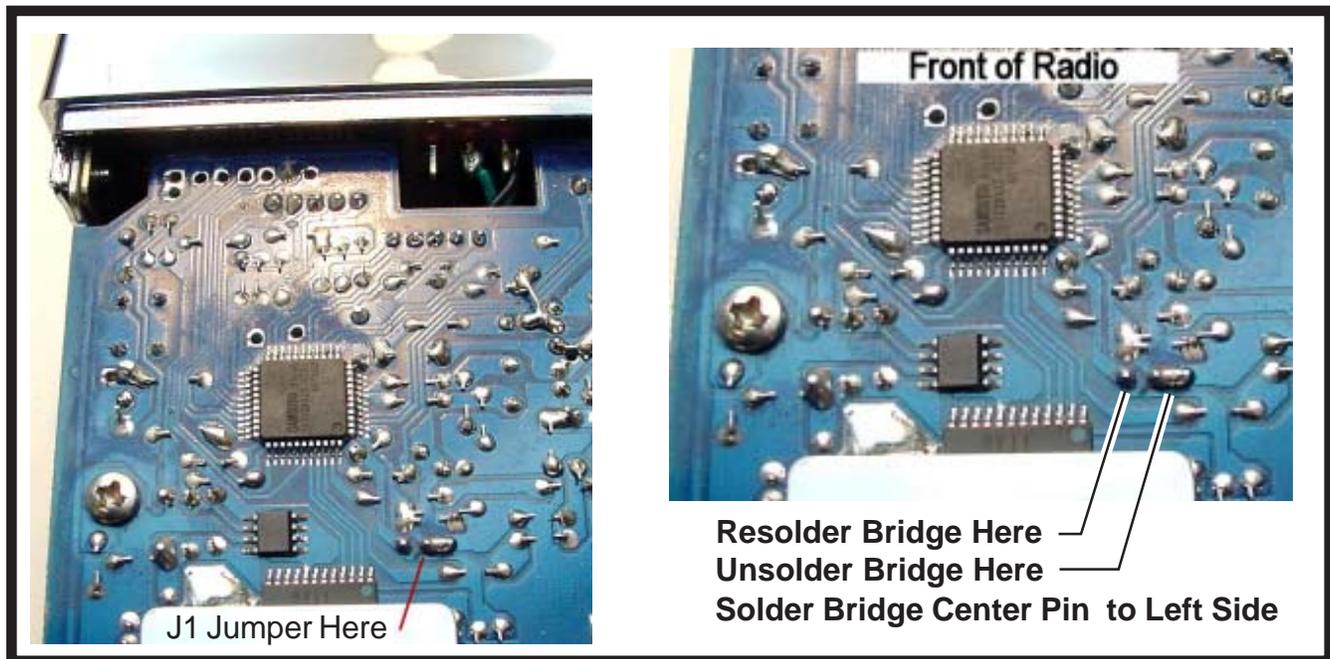

Instructions:

- * Remove the covers from the radio and locate the White J1 Jumper Block on the top side of the board. J1 is located about 2" behind the Channel Selector. The pins have been cut off so you will have to locate the Jumper on the bottom side of the board as shown in the diagram above.
- * Notice that the Center Pin and Right Pin are soldered together with a solder bridge. Unsolder that bridge and Resolder the bridge between the Center Pin and Left Pin of J1.
- * Locate the Microprocessor Reset Button just behind the Channel Selector Switch. Power Off the Radio and Hold Down the Reset Button for 5 Seconds. Power On the radio and the Band Selector should now function on All Frequencies!

